

# ECO INSPECTION CERTIFICATE

Premium

Order ID : 36619

121 Points Vehicle Inspection Certificate

ECO Inspection report is based on information received during physical inspection performed using ECO's proprietary methodology by trained and verified technicians. ECO inspection checklist is mutually exclusive and collectively exhaustive covering all the important points needed in verifying or inspecting a vehicle.


Ordered By : Ravi	Inspection Date : 2018-12-30	Valid Till : 2019-03-31
----------------------	---------------------------------	----------------------------

7/10

Overall Score

- ✔ Evaluated across **5** segments
- ✔ Covered **121+** checkpoints
- ✔ **107** does not need attention
- ✔ **1** Owner , **6** Years Vehicle Age
- ✔ No Accidental History

**Inspected By**



✔ **Verified Technician**

273+ vehicle inspected

1+ years experience

Arjun Kumar










## Bmw X1 SDRIVE20D, 2012



### VEHICLE INFORMATION

MAKE	BMW	TRANSMISSION TYPE	AUTOMATIC
MODEL	X1	REGISTRATION NO.	HR26BS5728
YEAR	2012	VIN/CHASIS NUMBER	R49839
TRIM	SDRIVE20D	KMS RUN	74708
COLOR	BLUE	INSURANCE EXPIRY	2019-4-21
BODY TYPE	HATCHBACK	LOCATION	DELHI
FUEL TYPE	DIESEL	ENGINE SOUND LINK	<a href="#">LISTEN ENGINE SOUND</a>

### KEY HIGHLIGHTS

 FLOOD DAMAGE	NO	 MAJOR ACCIDENT(S)	NO	 SERVICE LOGS AVAILABLE	YES (FULL)
 TYRE LIFE REMAINING (KM)	10,000	 RC COPY AVAILABLE	YES (ORIGINAL)	 BANK HYPOTHECATION	YES
 DENT	YES	 INSURANCE COPY AVAILABLE	YES (COMPREHENSIVE)	 BANK NOC	NO








Orange Book Value, a service by Droom is India's Only Algorithmic pricing engine. With this evaluation, the Fair Market Price for this vehicle comes to be:

11,06,710




### ECO SCORE & REPAIR COST ESTIMATE

#### ECO SCORE

 Interior	<div style="width: 70%; background-color: green;"></div>	<b>7 / 10</b>
 Wheel	<div style="width: 80%; background-color: green;"></div>	<b>8 / 10</b>
 Test Drive	<div style="width: 70%; background-color: green;"></div>	<b>7 / 10</b>
 Exterior	<div style="width: 60%; background-color: yellow;"></div>	<b>6 / 10</b>
 Hood	<div style="width: 70%; background-color: green;"></div>	<b>7 / 10</b>

#### TOTAL ESTIMATE SPEND 3,46,500

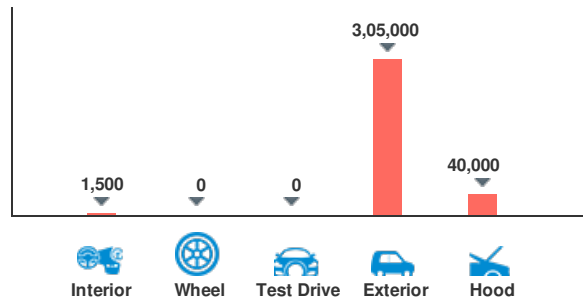

Ordered by: ravi | Inspected date: 2018-12-30

Order Id: 36619

Overall Score  **7/10**



**11,06,710**

## INTERIOR

**7/10**

INSPECTION CHECKPOINTS	SCORE(X/10)	REMARKS/COMMENTS	OPTIONAL SPEND EST. (RS)
DOOR PANEL	6	AVERAGE CONDITION	0
DOOR HINGES	7	PROPERLY LUBRICATED	0
CARPET & FLOOR MAT	6	AVERAGE CONDITION	0
SEAT & SEAT BELT	6	RHS SEAT HAVING CRACK MARKS	0
DASHBOARD & INSTRUMENT PANEL	7	WELL MAINTAINED	0
HORN	7	WORKING PROPERLY	0
SPEAKERS & MUSIC SYSTEM	8	WORKING PROPERLY AND SOUND GOOD	0
HANDBRAKE	7	WORKING PROPERLY	0
STEERING-MOUNTED CONTROLS	7	WORKING PROPERLY	0
PEDALS	7	GOOD CONDITION	0
CENTRAL LOCK	8	WORKING PROPERLY	0
A/C VENTS & HEATER	8	WORKING PROPERLY AND COOLING IS GOOD	0
CUP HOLDERS	6	AVERAGE CONDITION	0
NAVIGATION (NO)	10		0
ODOMETER	7	GOOD CONDITION	0
HAZARD LIGHT	7	PROPERLY BLINKING IN CLUSTER	0
POWER WINDOWS (YES)	5	P/W NOISY NEED CLEAN	1500

## IMAGES



Ordered by: ravi | Inspected date: 2018-12-30

Order Id: 36619

Overall Score  **7/10**



**11,06,710**

**NEED ATTENTION** ⚠️



**TEST DRIVE**

**7/10**

INSPECTION CHECKPOINTS	SCORE(X/10)	REMARKS/COMMENTS	OPTIONAL SPEND EST. (RS)
STEERING PERFORMANCE	7	WORKING PROPERLY	0
BRAKE PERFORMANCE	7	WORKING PROPERLY	0
CLUTCH PERFORMANCE	7	WORKING PROPERLY	0
ENGINE NOISE	8	NO NOISE IN IDEAL CONDITION	0
IGNITION SYSTEM	7	WORKING PROPERLY	0
SUSPENSION PERFORMANCE	6	AVERAGE CONDITION	0
SUSPENSION FRONT SHOCKS	6	AVERAGE CONDITION	0
SUSPENSION REAR SHOCKS	6	AVERAGE CONDITION	0
TRANSMISSION ENGAGE	7	SMOOTHLY ENGAGED	0
CRUISE CONTROL (NO)	10		0
REAR PARKING SENSORS (YES)	7	WORKING PROPERLY	0
REAR VIEW CAMERA (NO)	10		0

**IMAGES**



Ordered by: ravi | Inspected date: 2018-12-30

Order Id: 36619

Overall Score



7/10



11,06,710


## WHEEL



8/10

INSPECTION CHECKPOINTS	SCORE(X/10)	REMARKS/COMMENTS	OPTIONAL SPEND EST. (RS)
TYRES	7	GOOD CONDITION	0
SPARE TYRE (NO)	10		0
WHEEL ASSEMBLY (ALLOY RIM)	6	MINOR SCRATCHES	0

## IMAGES

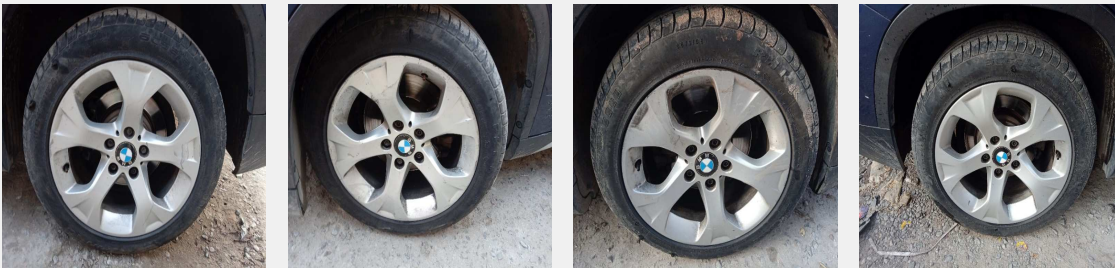

## NEED ATTENTION ⚠



## HOOD





7/10


INSPECTION CHECKPOINTS	SCORE(X/10)	REMARKS/COMMENTS	OPTIONAL SPEND EST. (RS)
LH APRON	7	GOOD CONDITION	0
RH APRON	7	GOOD CONDITION	0
RADIATOR	7	GOOD CONDITION	0
WIRING	8	GOOD CONDITION	0
BATTERY	7	FULLY CHARGED	0
BRAKE FLUID LEVEL	7	LEVEL OK	0

COOLANT LEVEL	7	LEVEL OK	0
BRAKE & COOLANT HOSE PIPES	6	AVERAGE CONDITION	0
UNDERCARRIAGE	7	GOOD CONDITION	0
EXHAUST SYSTEM	7	GOOD CONDITION	0
ENGINE OIL	3	LEVEL LOW NEED REQUIRED SERVICE	40000

## 🚗 IMAGES

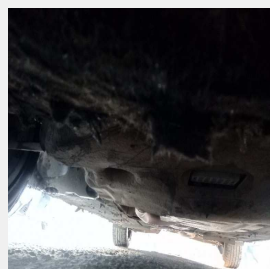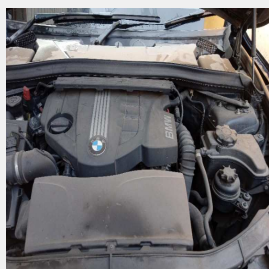

## 🚗 NEED ATTENTION ⚠️

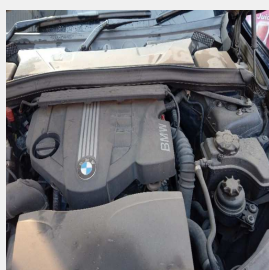

Ordered by: ravi | Inspected date: 2018-12-30

Order Id: 36619

Overall Score  **7/10**



**11,06,710**

 **EXTERIOR**

 **6/10**

INSPECTION CHECKPOINTS	SCORE(X/10)	REMARKS/COMMENTS	OPTIONAL SPEND EST. (RS)
LICENSE PLATE	8	GOOD CONDITION	0
TURN SIGNAL	7	WORKING PROPERLY	0
FOG LAMPS	7	WORKING PROPERLY	0
HOOD	6	MINOR SCRATCHES	0
PILLAR	7	GOOD CONDITION	0
FRONT WINDSHIELD	6	STONE SPOT MARK	0
LH REAR DOOR	6	SCRATCHES	0
LH RUNNING BOARD	6	SCRATCHES	0
LH QUARTER PANEL	6	SCRATCHES	0
FUEL LID	7	GOOD CONDITION	0
REAR WINDSHIELD	7	GOOD CONDITION	0
TRUNK LID/TAIL GATE	6	MINOR SCRATCHES	0
LUGGAGE COMPARTMENT LIGHT	7	WORKING PROPERLY	0
RH RUNNING BOARD	6	MINOR SCRATCHES	0
RH FENDER	6	SCRATCHES	0
BODY RUST	7	GOOD CONDITION	0
ROOF (REGULAR)	7	GOOD CONDITION	0
FRONT BUMPER	4	NEED REPAIR	20000
HEAD LIGHTS	3	LHS HEADLIGHT LOCK BROKEN NEED REPLACE HEADLIGHT	30000
GRILLE	4	NEED REPAIR IF POSSIBLE	10000
SIDE VIEW MIRRORS	3	LHS COMPLET NEED REPLACE BROKEN	15000
LH FENDER	4	SCRATCHES AND DENT NEED REPAIR	20000
LH FRONT DOOR	4	SCRATCHES AND DENT NEED	25000

LF FRONT DOOR	4	REPAIR	25000
REAR BUMPER	5	SCRATCHES NEED PAINT	30000

Ordered by: ravi | Inspected date: 2018-12-30

Order Id: 36619

Overall Score  **7/10**



**11,06,710**

## EXTERIOR (CONTINUED)

**6/10**

INSPECTION CHECKPOINTS	SCORE(X/10)	REMARKS/COMMENTS	OPTIONAL SPEND EST. (RS)
TAIL LIGHT	4	RHS CRACK NEED REPLACE	20000
RH QUARTER PANEL	4	SCRATCHES AND DENT NEED REPAIR	20000
RH REAR DOOR	4	SCRATCHES AND DENT NEED REPAIR	35000
RH FRONT DOOR	4	SCRATCHES AND DENT NEED REPAIR	30000
PAINT CONDITION	5	SCRATCHES AND DENT NEED REPAIRING AND TOUCHING	50000


## IMAGES



## NEED ATTENTION ⚠️





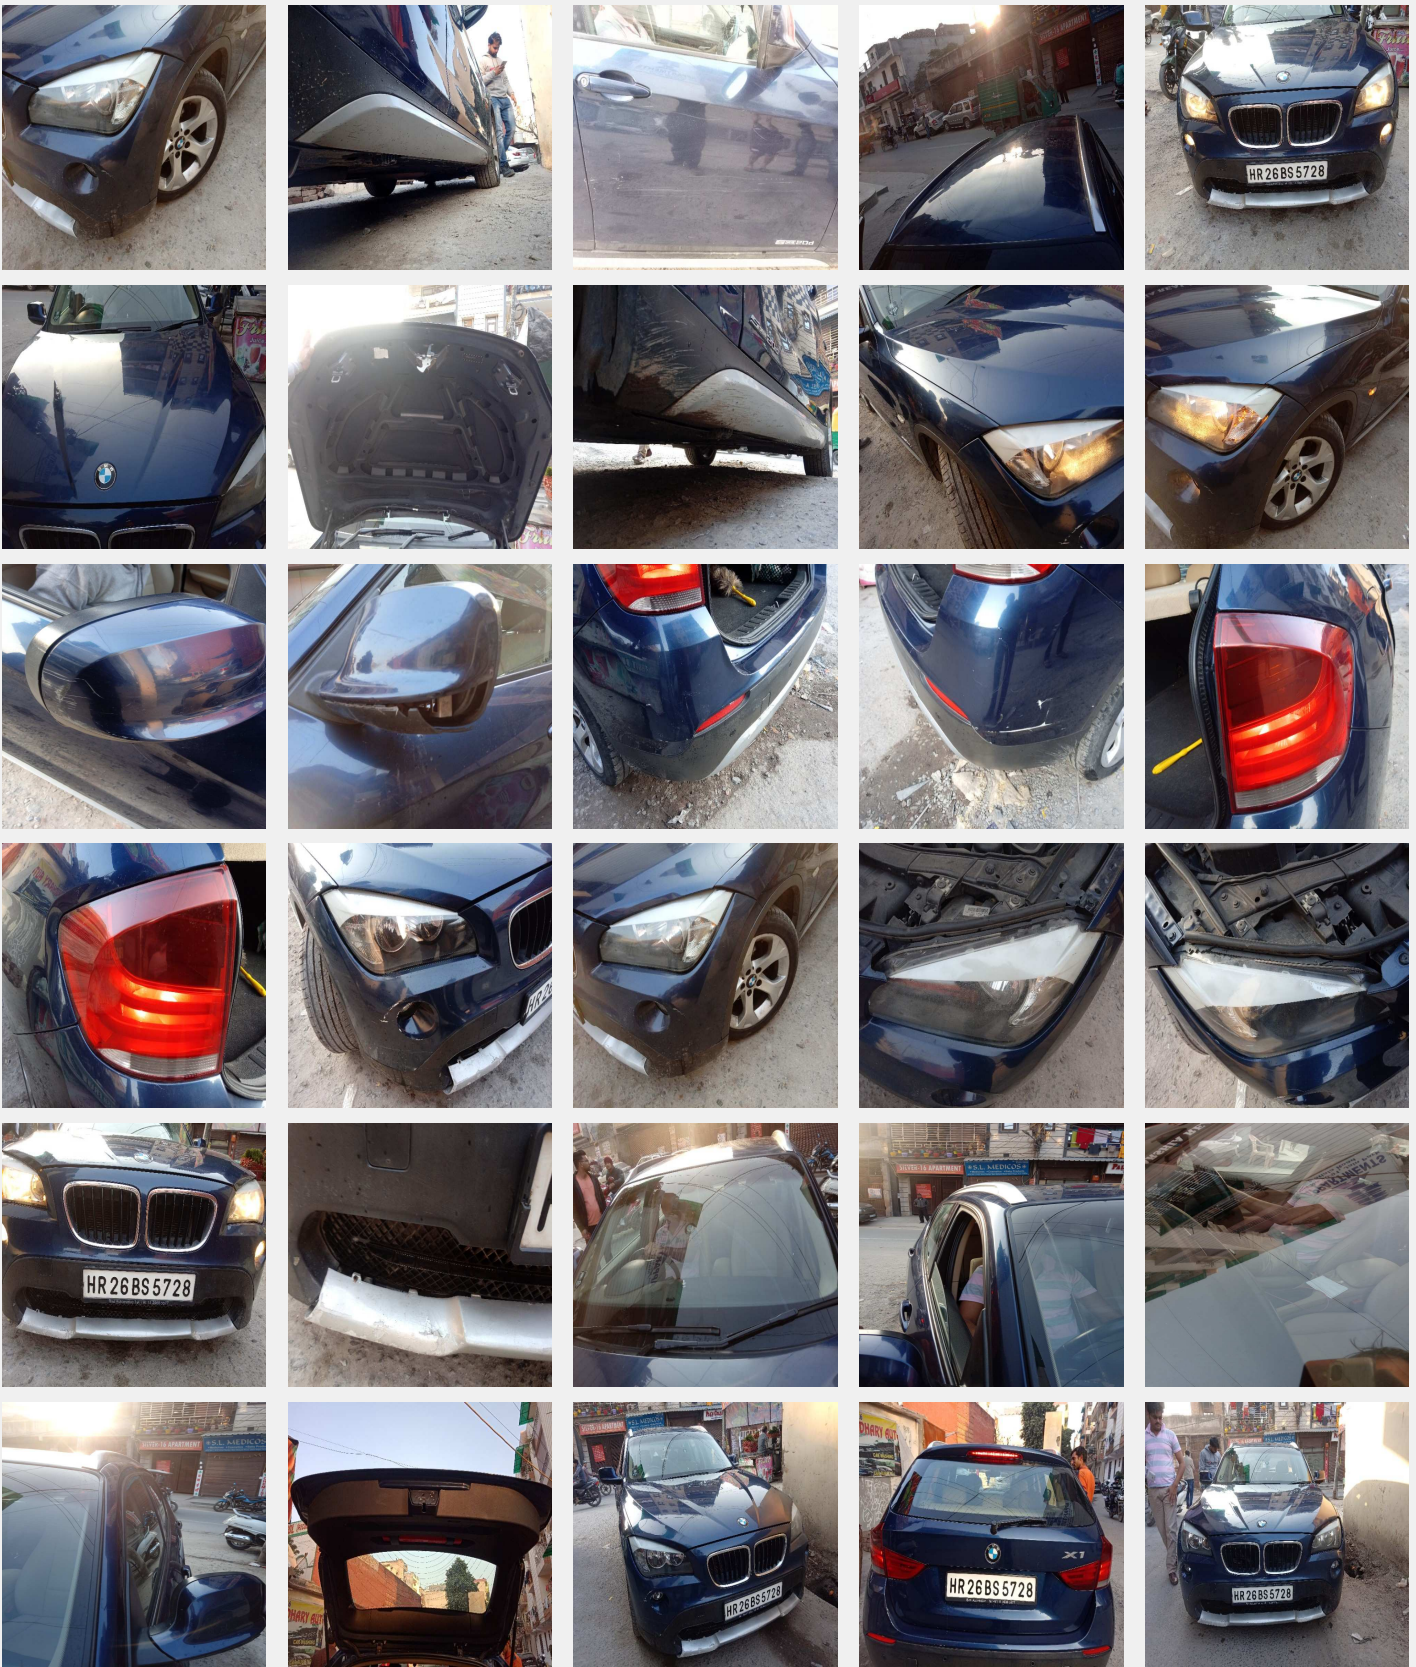



## DOCUMENTS

[www.droom.in/eco](http://www.droom.in/eco)

[eco@droom.in](mailto:eco@droom.in)

Contact No. 18004070707 (Toll Free)

-a service by  [droom.in](http://droom.in)

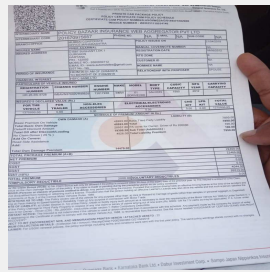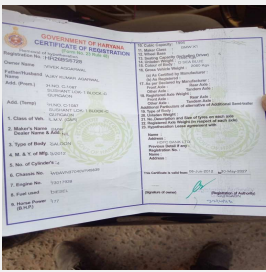

## DESCRIPTION

all body having Dent and scratches need repairing

Ordered by: ravi | Inspected date: 2018-12-30

Order Id: 36619

Overall Score



7/10



11,06,710

IMAGES





Ordered by: ravi | Inspected date: 2018-12-30

Order Id: 36619

Overall Score



7/10



11,06,710

## DISCLAIMER

This inspection report was generated by ECO, a service arm of Droom Technology Pvt Ltd. This report was generated based on the request raised by the party, whom the report is addressed to, for the stated purpose only. ECO will not be responsible for any loss incurred by the party relying on the inspection report.

All data presented in the report are based on the facts at the time of inspection and ECO cannot be held responsible for any discrepancy in the mentioned facts. ECO has not validated the authenticity of the odometer reading and is not responsible for any tampering performed by the current owner of the vehicle.

Ownership documents of the vehicle were verified by the technician performing the auto inspection. However, ECO is not responsible for validating the authenticity of the document.