


ECO INSPECTION CERTIFICATE

Premium

Order ID : 110788

121 Points Vehicle Inspection Certificate

ECO Inspection report is based on information received during physical inspection performed using ECO's proprietary methodology by trained and verified technicians. ECO inspection checklist is mutually exclusive and collectively exhaustive covering all the important points needed in verifying or inspecting a vehicle.

Ordered By : Harneet Singh	Inspection Date : 2019-09-24	Location : DELHI	Inspected By  Verified Technician 1134+ vehicle inspected 1+ years experience Lokesh Kumar
-------------------------------	---------------------------------	---------------------	--

7/10

Overall Score

- ✓ Evaluated across 6 segments
- ✓ Covered 121+ checkpoints
- ✓ 114 does not need attention
- ✓ 1 Owner , 3 Years Vehicle Age
- ✓ No Accidental History

Triumph Daytona 675 ABS, 2016



VEHICLE INFORMATION

MAKE	TRIUMPH	ENGINE NUMBER	76673
MODEL	DAYTONA	REGISTRATION NO.	DL8SBR9102
YEAR	2016	VIN/CHASSIS NUMBER	25996
TRIM	675 ABS	ODOMETER READING	8539
COLOR	RED	INSURANCE EXPIRY	2019-3-22
FUEL TYPE	PETROL	ENGINE SOUND LINK	LISTEN ENGINE SOUND

KEY OBSERVATIONS

FLOOD DAMAGE	NO	MAJOR ACCIDENT(S)	NO	SERVICE LOGS AVAILABLE	NO
TYRE LIFE REMAINING (KM)	24,000	RC COPY AVAILABLE	ORIGINAL	BANK HYPOTHECATION	NOT APPLICABLE
DENT	NO	INSURANCE COPY AVAILABLE	NO	BANK NOC	NO



Orange Book Value, a service by Droom is India's Only Algorithmic pricing engine. With this evaluation, the Fair Market Price for this vehicle comes to be:

7,35,949




ECO SCORE & REPAIR COST ESTIMATE

ECO SCORE

Tyre	<div style="width: 80%;"></div>	8 / 10
Control	<div style="width: 70%;"></div>	7 / 10
Light	<div style="width: 80%;"></div>	8 / 10
Oil	<div style="width: 50%;"></div>	5 / 10
Chassis	<div style="width: 60%;"></div>	6 / 10
Stand	<div style="width: 60%;"></div>	6 / 10

TOTAL ESTIMATE SPEND 0

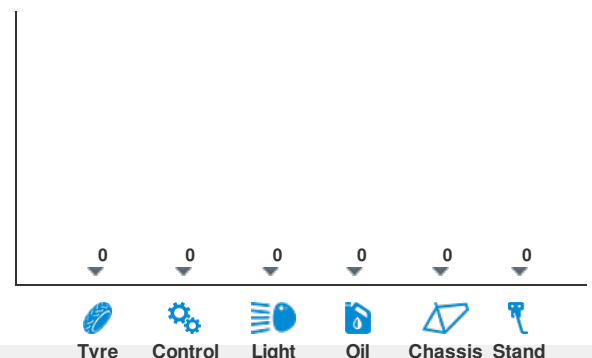

www.droom.in/eco

eco@droom.in

Contact No. 18004070707 (Toll Free)

-a service by .in

Ordered by: Harneet Singh | Inspected date: 2019-09-24

Order Id: 110788

Overall Score  **7/10**



7,35,949

TYRE

 **8/10**

INSPECTION CHECKPOINTS	SCORE(X/10)	REMARKS/COMMENTS	OPTIONAL SPEND EST. (RS)
FRONT TYRE CONDITION & AIR PRESSURE	8	FRONT TYRE IS IN GOOD CONDITION	0
REAR TYRE CONDITION & AIR PRESSURE	8	REAR TYRE IS IN GOOD CONDITION	0
WHEEL SPOKES FRONT	8	FRONT TYRE SPOKES ARE IN GOOD CONDITION	0
WHEEL SPOKES REAR	8	REAR TYRE SPOKES ARE IN GOOD CONDITION	0
WHEEL RIM FRONT	8	FRONT WHEEL ALLOY RIM IS IN GOOD CONDITION	0
WHEEL RIM REAR	8	REAR WHEEL ALLOY RIM IS IN GOOD CONDITION	0
WHEEL BEARINGS FRONT	8	FRONT WHEEL BEARING IS WORKING IN GOOD CONDITION	0
WHEEL BEARINGS REAR	8	REAR WHEEL BEARING IS WORKING IN GOOD CONDITION	0
WHEEL SEALS FRONT	8	WHEEL SEALS FRONT IS IN GOOD CONDITION	0
WHEEL SEALS REAR	8	WHEEL SEALS REAR IS IN GOOD CONDITION	0
BRAKE FUNCTION FRONT	6	FRONT BRAKE IS WORKING IN AVERAGE CONDITION	0
BRAKE FUNCTION REAR	8	REAR BRAKE IS WORKING IN GOOD CONDITION	0
BRAKES CONDITION FRONT	8	FRONT BRAKE IS WORKING IN GOOD CONDITION	0
BRAKES CONDITION REAR	8	REAR BRAKE IS WORKING IN GOOD CONDITION	0

IMAGES



Ordered by: Harneet Singh | Inspected date: 2019-09-24

Order Id: 110788

Overall Score



7/10



7,35,949

INSPECTION CHECKPOINTS	SCORE(X/10)	REMARKS/COMMENTS	OPTIONAL SPEND EST. (RS)
CENTRE STAND CONDITION	6	CENTRE STAND IS IN AVERAGE CONDITION	0
CENTRE STAND RETENTION	6	CENTRE STAND IS IN AVERAGE CONDITION	0
SIDE STAND CONDITION	6	SIDE STAND IS IN AVERAGE CONDITION	0
SIDE STAND RETENTION	6	SIDE STAND IS IN AVERAGE CONDITION	0

 IMAGES

 CONTROL

INSPECTION CHECKPOINTS	SCORE(X/10)	REMARKS/COMMENTS	OPTIONAL SPEND EST. (RS)
HANDLEBARS CONDITION	8	HANDLE GRIP IS IN GOOD CONDITION	0
LEVERS & PEDAL CONDITION	8	LEVERS & PEDAL ARE IN GOOD CONDITION	0
PIVOTS	8	PIVOTS ARE IN GOOD CONDITION	0
CABLES CONDITION	8	CABLE/TUBE IS IN GOOD CONDITION	0
CABLES ROUTING	6	CABLE/TUBE IS IN AVERAGE CONDITION	0
HOSES CONDITION	6	ALL HOSES/PIPES IS IN AVERAGE CONDITION	0
HOSES ROUTING	6	ALL HOSES/PIPES IS IN AVERAGE CONDITION	0
THROTTLE OPERATION	8	THROTTLE IS WORKING IN GOOD CONDITION	0

Ordered by: Harneet Singh | Inspected date: 2019-09-24

Order Id: 110788

Overall Score **7/10**



7,35,949

IMAGES




OIL

5/10

INSPECTION CHECKPOINTS	SCORE(X/10)	REMARKS/COMMENTS	OPTIONAL SPEND EST. (RS)
LEVELS - ENGINE OIL	6	ENGINE OIL IS IN AVERAGE CONDITION	0
LEVELS - COOLANT (YES)	6	COOLANT FLUID IS IN AVERAGE CONDITION	0
LEVELS - FUEL	6	FUEL IS IN AVERAGE CONDITION	0
LEVELS - GEAR OIL/SHAFT DRIVE (NO)	N/A		0
LEVELS - HYDRAULIC FLUID (NO)	N/A		0
LEAKS - ENGINE OIL	4	MINOR ENGINE OIL SEPAGE	0
LEAKS - GEAR OIL	4	MINOR GEAR OIL SEPAGE	0
LEAKS - HYDRAULIC FLUID	4	MINOR HYDRAULIC FLUID SEPAGE	0
LEAKS - COOLANT	4	MINOR COOLANT SEPAGE	0
LEAKS - FUEL	4	MINOR FUEL OIL SEPAGE	0

IMAGES

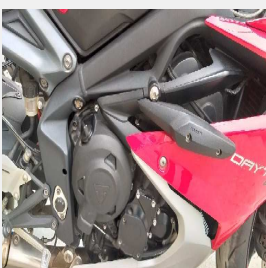

Ordered by: Harneet Singh | Inspected date: 2019-09-24

Order Id: 110788

Overall Score



7/10



7,35,949


 LIGHT



8/10

INSPECTION CHECKPOINTS	SCORE(X/10)	REMARKS/COMMENTS	OPTIONAL SPEND EST. (RS)
BATTERY CONDITION	6	BATTERY IS WORKING IN AVERAGE CONDITION	0
BATTERY VENT TUBE	6	CABLE/TUBE IS IN AVERAGE CONDITION	0
HEADLAMP CONDITION	8	HEAD LIGHTS ARE WORKING IN GOOD CONDITION	0
TAILLAMP/BRAKELAMP CONDITION	8	TAILLAMP/BRAKELAMP ARE WORKING IN GOOD CONDITION	0
TAILLAMP/BRAKELAMP OPERATION	8	TAILLAMP/BRAKELAMP ARE WORKING IN GOOD CONDITION	0
TURN SIGNALS OPERATION FRONT LEFT	8	FRONT LEFT INDICATOR IS WORKING IN GOOD CONDITION	0
TURN SIGNALS OPERATION FRONT RIGHT	8	FRONT RIGHT INDICATOR IS WORKING IN GOOD CONDITION	0
TURN SIGNALS OPERATION REAR LEFT	8	REAR LEFT INDICATOR IS WORKING IN GOOD CONDITION	0
TURN SIGNALS OPERATION REAR RIGHT	8	REAR RIGHT INDICATOR IS WORKING IN GOOD CONDITION	0
SWITCHES OPERATION	8	LIGHT/INDICATOR SWITCHES ARE WORKING IN GOOD CONDITION	0
MIRRORS CONDITION	8	MIRRORS ARE IN GOOD CONDITION	0
MIRRORS AIM	8	MIRRORS ARE IN GOOD CONDITION	0
LENSES & REFLECTORS CONDITION	6	LENSES & REFLECTORS ARE IN AVERAGE CONDITION	0
WIRING CONDITION	8	WIRING HARNESS IS IN GOOD CONDITION	0
WIRING ROUTING	8	WIRING HARNESS IS IN GOOD CONDITION	0

 IMAGES

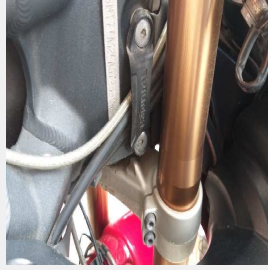

Ordered by: Harneet Singh | Inspected date: 2019-09-24

Order Id: 110788

Overall Score **7/10**



7,35,949

CHASSIS



6/10

INSPECTION CHECKPOINTS	SCORE(X/10)	REMARKS/COMMENTS	OPTIONAL SPEND EST. (RS)
FRAME CONDITION	6	BASE FRAME IS IN AVERAGE CONDITION	0
FRAME STEERING-HEAD BEARINGS	6	STEERING BEARING IS WORKING IN AVERAGE CONDITION	0
FRAME SWINGARM BUSHINGS	6	FRAME SWINGARM BUSHINGS IS IN AVERAGE CONDITION	0
SUSPENSION FRONT FORKS LEFT	6	FRONT LEFT FORK IS IN AVERAGE CONDITION	0
SUSPENSION FRONT FORKS RIGHT	6	FRONT RIGHT FORK IS IN AVERAGE CONDITION	0
SUSPENSION REAR SHOCKS LEFT	6	REAR LEFT SHOCK ABSORBER IS WORKING IN AVERAGE CONDITION	0
SUSPENSION REAR SHOCKS RIGHT	6	REAR RIGHT SHOCK ABSORBER IS WORKING IN AVERAGE CONDITION	0
CHAIN/BELT TENSION	6	DRIVE CHAIN TENSIONER IS IN AVERAGE CONDITION	0
CHAIN/BELT LUBRICATION	6	DRIVE CHAIN AVERAGE LUBRICATION	0
CHAIN/BELT SPROCKETS	6	DRIVE CHAIN SPROCKET IS IN AVERAGE CONDITION	0
FASTENERS THREADED	6	FASTENERS THREADED IS IN AVERAGE CONDITION	0
FASTENERS CLIPS & COTTER PINS	6	FASTENERS CLIPS & COTTER PINS IS IN AVERAGE CONDITION	0
ENGINE	6	ENGINE PERFORMANCE IS IN AVERAGE CONDITION	0
TRANSMISSION	6	TRANSMISSION PERFORMANCE IS IN AVERAGE CONDITION	0

IMAGES



Ordered by: Harneet Singh | Inspected date: 2019-09-24

Order Id: 110788

Overall Score



7/10



7,35,949



DOCUMENTS

S. Regulatory Authority: DDMV, OFFICE, NORTH WEST AND SPOK, Delhi			
Registration No:	DL5889103	Registration Date:	13-Apr-2018
Chassis No:	SMTTJG820749	Engine No:	57493
Owner Name:	HARNEET SINGH		
Vehicle Class:	IN Cycle Scooter (50)	Fuel:	PETROL
Make/Model:	TRIUMPH MOTORCYCLES (INDIA) PVT LTD SCARFOWERS		
Finance/Lease Date:	13-Apr-2018	Insurance Details:	New India Assurance Co. Ltd. 4th policy no. 019520190000000001 valid upto 18-Apr-2020
W. To type:	LT	REG. No./REG. No.	NA/NA
Exclusion marks:	BRAND STRIKE II	VC Status:	ACTIVE
Financier's Name:	HDFC BANK LTD 0843 here to see (1258) details		



DESCRIPTION

fair condition,,minor scratch

Ordered by: Harneet Singh | Inspected date: 2019-09-24

Order Id: 110788

Overall Score




7/10




7,35,949

IMAGES (17)

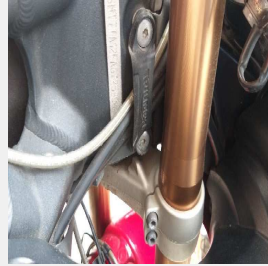

1. Registering Authority: ZWAL OFFICE, NORTH WEST WAZIRPUR, Delhi			
Registration No:	DL588002	Registration Date:	13-Apr-2016
Chassis No:	SMTT1A2E1672584	Engine No:	F7193
Owner Name:	HARNEET SINGH		
Vehicle Class:	14 Cycles (Sport)	Fuel:	PETROL
Make/Model:	TRIUMPH MOTORCYCLES (INDIA) PVT LTD DAYTONA 675		
Finance/Lease Type:	13-Apr-2016	Insurance Details:	New India Assurance Co. Ltd. 404 policy no. 1193221300000492 valid upto 10-Apr-2020
VIN Type:	LT1	PUC (year-PUC No)	16-164
Exclusion terms:	89 PART STRAIGHT W	RC Status:	ACTIVE
Franchisee Name:	HDFC BANK LTD. (ask here to see CDSR details)		

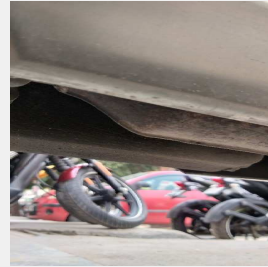

Ordered by: Harneet Singh | Inspected date: 2019-09-24

Order Id: 110788

Overall Score



7/10



7,35,949

DISCLAIMER

This inspection report was generated by ECO, a service arm of Droom Technology Pvt Ltd. This report was generated based on the request raised by the party, whom the report is addressed to, for the stated purpose only. ECO will not be responsible for any loss incurred by the party relying on the inspection report.

All data presented in the report are based on the facts at the time of inspection and ECO cannot be held responsible for any discrepancy in the mentioned facts. ECO has not validated the authenticity of the odometer reading and is not responsible for any tampering performed by the current owner of the vehicle.

Ownership documents of the vehicle were verified by the technician performing the auto inspection. However, ECO is not responsible for validating the authenticity of the document.